



## Solution Kits

**To his customers, Dave Steinke  
is known as:**



*It's not only Dave's customer service and 25 years as a Master Technician that make him a success, it's also the fact that he turns to Gates Solution Kits to improve the reliability of his customer's cars.*

*From belt jump off to chronic belt noise, we offer a line of specially engineered solutions to enhance Original Equipment drive designs so customer vehicles are better than when they left the showroom. His comebacks? Satisfied customers.*

*Solution Kits are precision engineered by Gates – The world's most experienced designer of accessory belt drive systems and manufacturer of premium quality parts. At Gates, we understand what you need to make your customers always ask for "The Man."*

**David Steinke**

Master Technician | 25 Years



(Solution Kit application list on reverse.)

# Gates Engineered Solution Kits

## Chrysler Voyager & Grand Voyager 3.3L 4 cyl., 1997-2001 Part number 38379K\*

- Under rain or snow conditions, the serpentine belt could come off.
- Kit includes double-sided Micro-V belt, grooved idler pulley & tensioner with grooved tensioner pulley.
- Delivers proper tension and performance to the belt drive making it virtually impossible for the belt to jump off.

Reference Technical Service Bulletin: 07-01-99 & 07-02-94

\*The OE waterpump pulley on these applications is smooth. Running the dual sided ribbed belt on this pulley's flat surface is acceptable and will not reduce the efficiency of the waterpump.



## Honda MDX 3.5L V6, 2002-2006 Part number 38327K

- Buzzing or humming sound from accessory drive, particularly at the alternator.
- Kit includes specially-constructed belt and upgraded tensioner.
- Provides proper pulley friction and tension to eliminate noise.

Reference Technical Service Bulletin: TSB 03-052



## Toyota Corolla 1.8L 4 cyl., 2003-2006 Part number 39068K2

- Noise from engine compartment during vehicle operation, especially after a cold soak.
- Kit includes specially-constructed belt, upgraded tensioner and alternator decoupler pulley.
- Provides proper tension and belt surface to correct problem.

Reference Technical Service Bulletin: EG021-07



## Toyota Rav4 2.4L 4-cyl., 2000-2006 Part number 38216K

- Noise from engine compartment during vehicle operation, especially after cold soak.
- Kit includes specially-constructed belt and upgraded tensioner.
- Provides proper tension and belt surface to correct problem.


Reference Technical Service Bulletin: TSB EG040-04




## Ford F-series trucks 7.3L diesel, 1999-2003

### \* Part numbers 22434K-1999 - April 28, 2001 & 22690K-April 29, 2001-2003

- Kit designed to correct OEM situation where upper radiator hose must be removed to replace the serpentine accessory drive belt.
- OE upper radiator hose is routed through accessory drive belt system (left photo). To replace belt, cooling system must be drained and upper hose removed, adding additional cost and labor.
- Kit includes upper & lower hose, FleetRunner® long-life fleet-rated belt.
- Kit designed to route upper hose around accessory drive system, allowing belt to be replaced without draining cooling system and removing radiator hoses (right photo) reducing labor by up to 50% on future belt replacement.

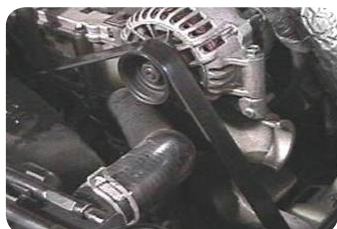

**Before**

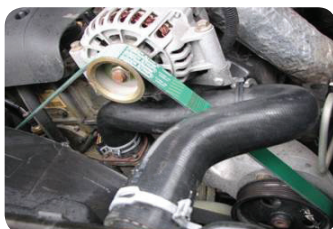

**After**

\* Lower Hose differs after April 28, 2001

**For more information  
contact your  
local Gates Sales  
Representative.**



[www.gatesaustralia.com.au](http://www.gatesaustralia.com.au)

